

## **November 2023 - PKGT Monitoring Summary Report**

The following Port Kembla Grain Terminal (PKGT) monthly monitoring summary report has been prepared by GrainCorp in accordance with Section 66 of the *Pollution of the Environment Operations Act 1997*. Monitoring data shared with the public on the website includes that collected as part of the Environmental Protection Licence (EPL) for the Port Kembla Grain Terminal Site. Monthly monitoring summaries are completed on the last day of any given month for the data collected.

#### Report contents

Section A. Map of PKGT and the location of sampling points as per the Environmental	al Protection Licence
---	-----------------------

		✓ Yes	□ No
Section B. PKGT fumigation emissions monitoring (Sampling Points 3,4,5,6,7 and 8)		see Section B	has not been included in report
	Monitoring triggered in this period	✓ Yes	□ No
Section C. PKGT interceptor water monitoring (Sampling Point 1)	and summarised in report?	see Section C	has not been included in report
		☐ Yes	✓ No
Section D. PKGT diesel boiler monitoring (Sampling Point 2)		see Section D	has not been included in report

### Site details

EPL Number	3693
Licensee Name	GrainCorp Operations Limited
Address	Port Kembla Grain Terminal, Morton Way, Port Kembla NSW 2505
FDI Dublic Register Link	http://www.ena.nsw.gov.au/prnoepann/Detail.aspx?instid=3693&id=3693&pntion=licence&searchrange=licence⦥=POFO licence&prn=no&status=Issued


#### **Technical Reviewer**

L. McDonald Name 18/12/2023 Date

#### Date published to website

19/12/2023 Date

# A. Sampling points as per EPL - Port Kembla Grain Terminal

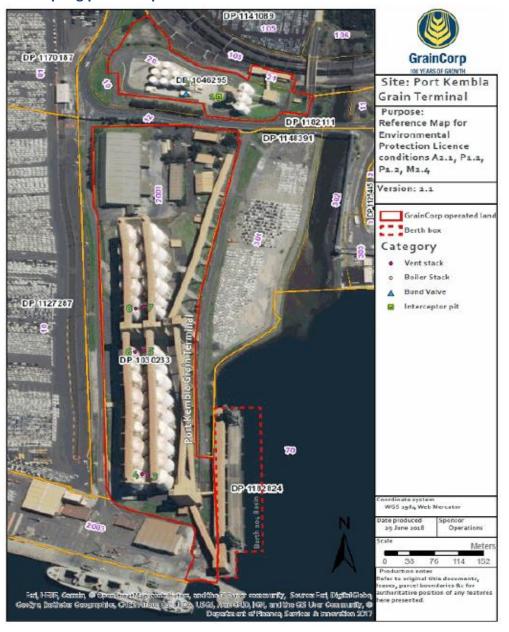

### **Environment Protection licence (EPL) Monitoring Locations**

Point	Location at PKGT
1	Located at the Bulk Liquid Storage area of the Port Kembla Grain Terminal. The water sample is collected downstream the bund valve from the final section of the interceptor.
2	Diesel boiler air vent located within the bulk liquid storage area directly east of the bulk storage tank area bund.
3 and 4	Most southern fumigation vents located beside silos A1 and B1.
5 and 6	Fumigation vent located in the centre of the site beside silos A9 and B9.
7 and 8	The northern most fumigation vents located beside silos A10 and B10, just north of points 5 and 6.

#

### B. GrainCorp - Port Kembla Fumigation monitoring data summary: November 2023

All air monitoring has been conducted in accordance with the methodology prescribed or a methodology approved in writing with NSW EPA.

Monitoring frequency: Continuous during every ventilation

No. of ventilation events during month: 2

					Exceedance			Res	sult	Limit								
Sampling date (ventilation event)	Pollutant (discharged to air)  Silo Vent No.  Silo Vent Initial Purge end time*  More than one silo vent in initial purge phase?* (yes/no)  Sampler		gator) Parameter	Min. value	Max. value	100 percentile (allowable)	Units of measure	Monitoring point location	Exceedance (yes/no)									
	Single silo ventilation event																	
10/11/2023				,		no R. Newton	Concentration	NA	4.8909	8	grams per second		no					
	Methyl Bromide	B11	16:03	n/a	no		Velocity	1.54	NA	1.4	metres per second	8	no					
10, 11, 1010	Second silo ventilation event																	
	No discharge occurred						Concentration	NA		-	grams per second							
														Velocity		NA	-	metres per second
	Single silo ventilation event																	
	Phosphine B10 11:03	R10	11:03	n/a	No	R. Newton	Concentration	NA	0.0369	0.0424	grams per second	. 8	no					
		11/ a	11/ a	11/ a	11/a	NO	140	NO	n/a NO	K. Newton	Velocity	0.65	NA	0.5	metres per second	o o	no	
23/11/2023	Second silo ventilation event																	
	No discharge occurred						Concentration	NA		-	grams per second							
			Velocity		NA	-	metres per second	_										

# C. GrainCorp - Port Kembla water monitoring data summary: November 2023

The concentration of each pollutant specified below has been determined using the required sampling method, units of measure and sample frequency specified in the EPL. Water parameters and water samples are collected by suitably qualified staff and, where required, water samples are analysed at a NATA accredited laboratory.

Monitoring frequency: Single sample each day during any discharge (i.e. daily)

Number of water release events during month: 6

**Monitoring Point Location: Point 1** 

			Result		Limit		
Number of times measured/sampled during month	Pollutant (discharge to water)	Min. value	Max. value	Visible or not visible?	100 percentile (allowable)	Units of measure	Exceedance (yes/no)
	Oil and Grease	NA	NA	Not visible	Not visible	Visible	no
6	pH	4.57	6.92		6.5-8.5	pН	no
6	Total suspended solids	0	2.15	NA	50	mg/L	no
	Turbidity	<5	8		40	NTU	no
	•	•	•			•	•

Sampling Event details								
Sampling date	Sampler	Lab report date	Lab report ID					
5/11/2023	D. Jackson	13/11/2023	EW2304907					
10/11/2023	D. Jackson	17/11/2023	EW2304999					
24/11/2023	B.Loke	2/12/2023	EW2305304					
27/11/2023	D. Jackson	4/12/2023	EW2305305					
29/11/2023	B.Loke	11/12/2023	EW2305346					
30/11/2023	B.Loke	11/12/2023	EW2305348					

Unit of Measure Abbreviation	Unit of Measure
mg/L	milligrams per litre
рН	pH
Visible	Visible
NTU	nephelometric turbidity units